








ID	External_doc	External_risks
 100208-3315	<p>It was possible to change the zone-name using the double click on the zone name.</p> <p>This possibility is no longer available, the user have to use the main menue "edit zone".</p>	none
 100208-5064	<p>The chart and table print functions that were removed with reference 4888 (Saveris 21 CFR Part 11 only) have been added again.</p>	none
 100208-5125	<p>The channel alarm configuration user interface did not revert unapplied Alarm settings. Thus the settings shown on the PC screen did not match the system settings every time.</p> <p>The issue has been fixed.</p>	none
 100208-5128	<p>In the 21CFR11 software edition testo-comsoft-users and testo-comsoft-powerusers where unable to edit comments for alarm acknowledgement.</p> <p>The issue has been fixed.</p>	none
 100208-5146	<p>The version 4.5 SP2 has introduced an error in temperature gradient alarm processing. This is gradient alarm only: -273.15 had been added to the limit value.</p> <p>The error has been fixed.</p>	none
 100208-5160	<p>In version 4.5 SP2 the Czech translation contained errors.</p> <p>The issue has been fixed.</p>	none
 100208-5161	<p>Saveris report's alarm section: in rare cases column headers were missing on the last page of the Alarm log.</p> <p>The text "no alarms have been recorded ..." was printed instead, followed by a single Alarm log row.</p> <p>The issue has been fixed.</p>	none